



Aviation Technical Bulletin

Route to:SERVICE
MANAGERSALES
MANAGERBULLETIN
BOARD*Bringing Power to Flight®*

July 05, 1996

No. 96-1

CHAMPION CH38016 IGNITER


The CH38016 igniter incorporates a semiconductor material which bridges the electrodes and is required for proper function of ignition. When servicing this type of igniter, care must be taken so as not to disturb the semiconductor material.

CLEANING



1. Wipe combustion deposits from exterior with a lint-free cloth.
2. DO NOT DISTURB THE COMBUSTION DEPOSITS IN THE GAP AREA.
NOTE: If gap area deposits must be removed for a closer inspection, they may be removed by a wood scraper. DO NOT TOUCH SEMICONDUCTOR SURFACE DEPOSITS IN THE GAP AREA; They aid plug operation.
3. Terminal well may be cleaned with a felt swab saturated in mineral spirits or isopropyl alcohol, using caution not to damage the terminal pin.

INSPECTION

1. Visually check for mechanical damage. Reject if it shows impact damage, if connector well or firing end insulator is cracked or loose, or if connector pin is badly bent or broken.
2. Check firing end shell for chafing or fretting wear. This wear is not to exceed 0.015 inches. If this wear is more than one-half the circumference of the shell, reject.
3. Reject if shell body is swollen or distorted.
4. Check igniter plug for electrical erosion. If erosion is equal to, or exceeds this measurement, reject. SEE ILLUSTRATIONS.

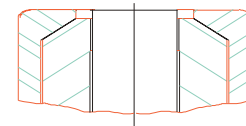

NEW

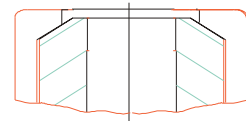 

USED

TESTING

1. Spark Test. Test at normal open air pressure using the standard engine ignition unit, including the shielded lead and terminal fittings.
2. Connect the ignition unit to the igniter.
3. Clamp the igniter with the firing end up.
4. Switch on the ignition unit. Wait 30 seconds. (If misfiring or irregularity in spark occurs, discard the igniter.)
5. Turn off the ignition unit.

WARNING: THE OUTPUT OF THIS IGNITION SYSTEM IS SUFFICIENT TO CAUSE A LETHAL ELECTRICAL SHOCK. DO NOT TOUCH ANY EXPOSED OR LIVE PORTION. ALWAYS DISCONNECT LEADS FROM INPUT POWER SOURCE AND WAIT AT LEAST ONE (1) MINUTE TO PERMIT STORED ENERGY TO DISSIPATE BEFORE WORKING WITH IGNITION UNIT.

6. Wait for at least one (1) minute to elapse; disconnect the igniter from the ignition unit; unclamp the igniter.

These commodities, technology or software were exported from the United States in accordance with the Export Administration Regulations. Diversion contrary to U.S. law is prohibited.
U.S. Export Classification: ECCN 9E991

Champion Aviation Products: Your Blueprint for Performance