



AVIATION TECHNICAL BULLETIN

Champion Spark Plug Company

P. O. BOX 910, TOLEDO, OHIO 43601

ROUTE TO	
SERVICE MANAGER	
SALES MANAGER	
BULLETIN BOARD	

January 6, 1975

NO. 75-1


**CONTROLLED
COPY**

THE MODEL 2400 DRY ABRASIVE CLEANER

Recently, Champion Spark Plug Company was notified that the new Model 2400 Dry Abrasive Cleaner did not function properly, due to poor cleaning action.

Investigation of this cleaner indicates the problem involves the positioning of the heavy duty nozzle tip, Part No. 8-850 in the rubber nozzle tip, Part No. 622. In most cases, the carbide tip is positioned too far into the rubber tip.

Please refer to the following illustration:

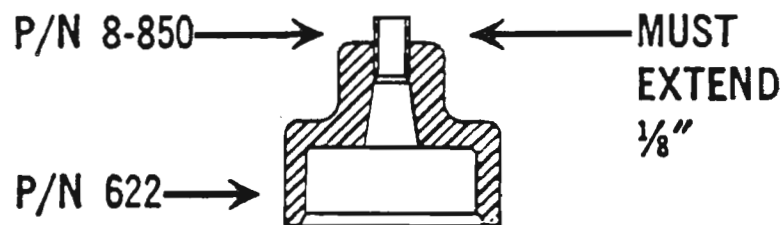

Repositioning of the carbide tip as illustrated above will correct the poor cleaning action problems.
