



Aviation Action Alert

Route to:	
SERVICE MANAGER	
SALES MANAGER	
BULLETIN BOARD	

Bringing Power to Flight

NOVEMBER 1993

PWC S.I.L. NO. GEN 20103

Action Alert #93-1

CH34055 and CH34406 IGNITER INSPECTION
(PWC 3035102) (PWC 3035882)

TO: All PT6A, PT6B, PT6T Series (Spark ignition), PW100 Series Operators

Champion is requesting the return of CH34055 and CH34406 igniters shipped during the period of July through October 1993, on which the following identification numbers appear on the poly tube label (sample of label shown below):

- | | | | |
|-----------------|----------------------|-----------------|-------------|
| CH34055: | W/O M121873 | CH34406: | W/O M141418 |
| | W/O M141237 | | W/O M141420 |
| | W/O M14123,A | | W/O M141422 |
| | W/O M1437,A | | W/O M141463 |
| | W/O M1439,E, F, G, H | | W/O M1422 |
| | W/O M1447,A, B | | W/O M1641 |
| | W/O M1448,B | | |
| | W/O M172450 | | |
| | W/O M172452 | | |
| | W/O RES239,A, B, C | | |
| | W/O RES248 | | |
| | W/O RES448 | | |



← ID #

Please inspect all igniters in inventory. For igniters installed during the period of July through November 1993, inspect igniter to ensure that it is positively seated against the engine case and the gasket, when torqued per the appropriate Engine Maintenance Manual. Check to ensure that the gasket does not rotate or move. If the gasket rotates, replace igniter. **This should be performed at the next scheduled inspection of the Igniter Plugs.**

This return has been initiated as a precaution to allow reinspection of igniters which may have incomplete installation threads. Champion is taking this step to insure that all products meet our stringent quality requirements.

Please return all shelf inventory of CH34055 and CH34406 igniters which display the above noted identification numbers to our technical services department, **Champion Aviation Products, Attn: Bill Austin, 1230 Old Norris Road, Liberty, SC 29657, Phone (803) 843-5400** or to your distributor for handling. After receipt of the igniters, we will return the inspected parts to you within five (5) working days or sooner. All affected igniters which pass our inspection will have the initials "BA" laser marked on the hex.

Please do not ship freight collect. We will reimburse all documented surface freight charges relating to this return. Copies of paid freight bills should be forwarded to the attention of Bill Austin for prompt credit.

We apologize for any inconvenience this inspection may cause. Please don't hesitate to contact Champion or your Champion representative if you have any questions.

WLA/sg